# Functional Safety Information

# TMUX7219-Q1

# Functional Safety FIT Rate, FMD and Pin FMA



#### **Table of Contents**

1 Overview	2
2 Functional Safety Failure In Time (FIT) Rates	
3 Failure Mode Distribution (FMD)	
4 Pin Failure Mode Analysis (Pin FMA)	

#### **Trademarks**

All trademarks are the property of their respective owners.



#### 1 Overview

This document contains information for TMUX7219-Q1 (DGK-8 package) to aid in a functional safety system design. Information provided are:

- Functional Safety Failure In Time (FIT) rates of the semiconductor component estimated by the application of industry reliability standards
- Component failure modes and their distribution (FMD) based on the primary function of the device
- Pin failure mode analysis (Pin FMA)

Figure 1-1 shows the device functional block diagram for reference.

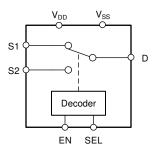


Figure 1-1. Functional Block Diagram

TMUX7219-Q1 was developed using a quality-managed development process, but was not developed in accordance with the IEC 61508 or ISO 26262 standards.

### 2 Functional Safety Failure In Time (FIT) Rates

This section provides Functional Safety Failure In Time (FIT) rates for TMUX7219-Q1 based on two different industry-wide used reliability standards:

- Table 2-1 provides FIT rates based on IEC TR 62380 / ISO 26262 part 11
- Table 2-2 provides FIT rates based on the Siemens Norm SN 29500-2

Table 2-1. Component Failure Rates per IEC TR 62380 / ISO 26262 Part 11

•	
FIT IEC TR 62380 / ISO 26262	FIT (Failures Per 10 <sup>9</sup> Hours)
Total Component FIT Rate	8
Die FIT Rate	4
Package FIT Rate	4

The failure rate and mission profile information in Table 2-1 comes from the Reliability data handbook IEC TR 62380 / ISO 26262 part 11:

- Mission Profile: Motor Control from Table 11
- Power dissipation: 100 mW
- Climate type: World-wide Table 8
- Package factor (lambda 3): Table 17b
- Substrate Material: FR4
- EOS FIT rate assumed: 0 FIT

Table 2-2. Component Failure Rates per Siemens Norm SN 29500-2

Table	Category	Reference FIT Rate	Reference Virtual T <sub>J</sub>
5	BICMOS ASICs Analog and Mixed =<50 V supply	20 FIT	55 °C

The Reference FIT Rate and Reference Virtual T<sub>.1</sub> (junction temperature) in Table 2-2 come from the Siemens Norm SN 29500-2 tables 1 through 5. Failure rates under operating conditions are calculated from the reference failure rate and virtual junction temperature using conversion information in SN 29500-2 section 4.



### 3 Failure Mode Distribution (FMD)

The failure mode distribution estimation for TMUX7219-Q1 in Table 3-1 comes from the combination of common failure modes listed in standards such as IEC 61508 and ISO 26262, the ratio of sub-circuit function size and complexity and from best engineering judgment.

The failure modes listed in this section reflect random failure events and do not include failures due to misuse or overstress.

Die Failure Modes

MUX no output (HIZ)

MUX channel stuck on

MUC channel stuck off

MUC functional out of specification voltage or timing

Failure Mode Distribution (%)

20%

10%

10%

60%

Table 3-1. Die Failure Modes and Distribution

The FMD in Table 3-1 excludes short circuit faults across the isolation barrier. Faults for short circuit across the isolation barrier can be excluded according to ISO 61800-5-2:2016 if the following requirements are fulfilled:

- 1. The signal isolation component is OVC III according to IEC 61800-5-1. If a SELV/PELV power supply is used, pollution degree 2/OVC II applies. All requirements of IEC 61800-5-1:2007, 4.3.6 apply.
- 2. Measures are taken to ensure that an internal failure of the signal isolation component cannot result in excessive temperature of its insulating material.

Creepage and clearance requirements should be applied according to the specific equipment isolation standards of an application. Care should be taken to maintain the creepage and clearance distance of a board design to ensure that the mounting pads of the isolator on the printed-circuit board do not reduce this distance.

## 4 Pin Failure Mode Analysis (Pin FMA)

This section provides a Failure Mode Analysis (FMA) for the pins of the TMUX7219-Q1. The failure modes covered in this document include the typical pin-by-pin failure scenarios:

- Pin short-circuited to Ground (see Table 4-2)
- Pin open-circuited (see Table 4-3)
- Pin short-circuited to an adjacent pin (see Table 4-4)
- Pin short-circuited to supply (see Table 4-5)

Table 4-2 through Table 4-5 also indicate how these pin conditions can affect the device as per the failure effects classification in Table 4-1.

	- 1 11 11 014001110411011 01 1 411410 <u></u>
Class	Failure Effects
А	Potential device damage that affects functionality
В	No device damage, but loss of functionality
С	No device damage, but performance degradation
D	No device damage, no impact to functionality or performance

**Table 4-1. TI Classification of Failure Effects** 

Figure 4-1 shows the TMUX7219-Q1 pin diagram. For a detailed description of the device pins please refer to the *Pin Configuration and Functions* section in the TMUX7219-Q1 data sheet.



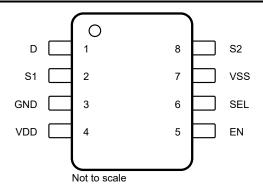


Figure 4-1. Pin Diagram

#### Table 4-2. Pin FMA for Device Pins Short-Circuited to Ground

Pin Name	Pin No.	Description of Potential Failure Effect(s)	Failure Effect Class
D	1	Possible corruption of the signal passed onto the SX and D pin.	В
S1	2	Corruption of the signal passed onto the D pin. If there is no limiting resistor in the switch path, then device damage is possible.	Α
GND	3	There is no effect; this is normal operation.	D
VDD	4	Device is unpowered and not functional.	В
EN	5	Enable is stuck low. Can no longer turn off the device.	В
IN	6	Address is stuck low. Cannot control the switch states.	В
VSS	7	There is no effect; this is normal operation, if the switch path signal voltages are positive. Possible damage to device if the switch path signal voltages are negative. Observe that the absolute maximum ratings for all pins of the device are met, otherwise device damage may be plausible.	А
S2	8	Corruption of the signal passed onto the D pin. If there is no limiting resistor in the switch path, then device damage is possible.	А

Table 4-3. Pin FMA for Device Pins Open-Circuited

Pin Name	Pin No.	Description of Potential Failure Effect(s)	Failure Effect Class
D	1	Corruption of the signal passed onto the S pins.	В
S1	2	Corruption of the signal passed onto the D pin.	В
GND	3	Device is unpowered and not functional.	В
VDD	4	Device is unpowered and not functional.	В
EN	5	Loss of control of the EN pin. Cannot turn off the device.	В
IN	6	Loss of control of the address pin. Cannot control the switch.	В
VSS	7	Device is unpowered and not functional.	В
S2	8	Corruption of the signal passed onto the D pin.	В

Table 4-4. Pin FMA for Device Pins Short-Circuited to Adjacent Pin

Pin Name	Pin No.	Shorted to	Description of Potential Failure Effect(s)	Failure Effect Class
D	1	S1	Possible corruption of the signal passed onto the SX and D pin.	В
S1	2	GND	Corruption of the signal passed onto the D pin. If there is no limiting resistor in the switch path, then device damage is possible.	А
GND	3	VDD	Device is unpowered and not functional. Observe that the absolute maximum ratings for all pins of the device are met, otherwise device damage may be plausible.	А
VDD	4	EN	Not considered. This is a corner pin.	D
EN	5	IN	There is loss of control of the switch state.	В



## Table 4-4. Pin FMA for Device Pins Short-Circuited to Adjacent Pin (continued)

Pin Name	Pin No.	Shorted to	Description of Potential Failure Effect(s)	Failure Effect Class
IN	6	VSS	Possible damage to the device if the signal voltage is negative. Observe that the absolute maximum ratings for all pins of the device are met, otherwise device damage may be plausible.	А
VSS	7	S2	Corruption of the signal passed onto the D pin. If there is no limiting resistor in the switch path, then device damage is possible.	Α
S2	8	D	Not considered. This is a corner pin.	D

#### Table 4-5. Pin FMA for Device Pins Short-Circuited to VDD

Pin Name	Pin No.	Description of Potential Failure Effect(s)	Failure Effect Class
D	1	Corruption of the signal passed onto the S pins. If there is no limiting resistor in the switch path, then device damage is possible.	Α
S1	2	Corruption of the signal passed onto the D pin. If there is no limiting resistor in the switch path, then device damage is possible	Α
GND	3	Device is unpowered and not functional. Observe that the absolute maximum ratings for all pins of the device are met, otherwise device damage may be plausible.	Α
VDD	4	There is no effect; this is normal operation.	D
EN	5	Enable is stuck high. Can no longer turn off the device.	В
IN	6	Address is stuck high. Cannot control switch states.	В
VSS	7	Device is unpowered and not functional. Observe that the absolute maximum ratings for all pins of the device are met, otherwise device damage may be plausible.	А
S2	8	Corruption of the signal passed onto the D pin. If there is no limiting resistor in the switch path, then device damage is possible.	А

#### Table 4-6. Pin FMA for Device Pins Short-Circuited to VSS

Pin Name	Pin No.	Description of Potential Failure Effect(s)	Failure Effect Class
D	1	Corruption of the signal passed onto the S pins. If there is no limiting resistor in the switch path, then device damage is possible.	А
S1	2	Corruption of the signal passed onto the D pin. If there is no limiting resistor in the switch path, then device damage is possible.	Α
GND	3	Controls is stuck high. Can no longer turn off the device.	В
VDD	4	Possible damage to the device if the signal voltage is negative. Observe that the absolute maximum ratings for all pins of the device are met, otherwise device damage may be plausible.	Α
EN	5	Possible damage to the device if the signal voltage is negative. Observe that the absolute maximum ratings for all pins of the device are met, otherwise device damage may be plausible.	А
IN	6	Possible damage to the device if the signal voltage is negative. Observe that the absolute maximum ratings for all pins of the device are met, otherwise device damage may be plausible.	А
VSS	7	There is no effect; this is normal operation.	D
S2	8	Corruption of the signal passed onto the D pin. If there is no limiting resistor in the switch path, then device damage is possible.	Α

#### IMPORTANT NOTICE AND DISCLAIMER

TI PROVIDES TECHNICAL AND RELIABILITY DATA (INCLUDING DATA SHEETS), DESIGN RESOURCES (INCLUDING REFERENCE DESIGNS), APPLICATION OR OTHER DESIGN ADVICE, WEB TOOLS, SAFETY INFORMATION, AND OTHER RESOURCES "AS IS" AND WITH ALL FAULTS, AND DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING WITHOUT LIMITATION ANY IMPLIED WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE OR NON-INFRINGEMENT OF THIRD PARTY INTELLECTUAL PROPERTY RIGHTS.

These resources are intended for skilled developers designing with TI products. You are solely responsible for (1) selecting the appropriate TI products for your application, (2) designing, validating and testing your application, and (3) ensuring your application meets applicable standards, and any other safety, security, regulatory or other requirements.

These resources are subject to change without notice. TI grants you permission to use these resources only for development of an application that uses the TI products described in the resource. Other reproduction and display of these resources is prohibited. No license is granted to any other TI intellectual property right or to any third party intellectual property right. TI disclaims responsibility for, and you will fully indemnify TI and its representatives against, any claims, damages, costs, losses, and liabilities arising out of your use of these resources.

TI's products are provided subject to TI's Terms of Sale or other applicable terms available either on ti.com or provided in conjunction with such TI products. TI's provision of these resources does not expand or otherwise alter TI's applicable warranties or warranty disclaimers for TI products.

TI objects to and rejects any additional or different terms you may have proposed.

Mailing Address: Texas Instruments, Post Office Box 655303, Dallas, Texas 75265 Copyright © 2022, Texas Instruments Incorporated